

SOIL AND SITE EVALUATION

accord with Comm 83.05, Wis. Adm. Code

Certified Soil Testing

Attach complete site plan on paper not less than 8 1/2 x 11 inches in size. Plan must include, but not limited to: vertical and horizontal reference point (BM), direction and percent slope, scale or dimensions, north arrow, and location and distance to nearest road.

County	Dunn
Parcel I.D.#	CSM Pending from Lot 10
Reviewed By	Date

APPLICANT INFORMATION - Please print all information.

Personal information you provide may be used for secondary purposes (Privacy Law, s. 15.04 (1) (m)).

Property Owner Liptak, Les	Property Location Govt. Lot SE 1/4 SE 1/4 S 17 T 29 N,R 12 W
Property Owner's Mailing Address E 6016 852nd Ave.	Lot # 10 Block # Subd. Name or CSM# CSM Pending
City Colfax State WI Zip Code 54730 Phone Number 715-962-4424	<input type="checkbox"/> City <input type="checkbox"/> Village Tainter <input checked="" type="checkbox"/> Town Nearest Road 852Nd Ave.

New Construction Use: Residential / Number of bedrooms 3 Addition to existing building _____
 Replacement Use: Public or commercial describe _____

Code Derived daily flow 450 gpd Recommended design loading rate .7 bed, gpd/ft² .8 trench, gpd/ft²
Absorption area required 643 bed, ft² 562 trench, ft² Maximum design loading rate .7 bed, gpd/ft² .8 trench, gpd/ft²

Recommended infiltration surface elevation(s) 93.2 ft (as referred to site plan benchmar
Additional design / site considerations install 2 - 2.7' x 56.25' Sidewinder, Hi-capacity "turtle-shell" trenches for 3 br

Parent material sandy/loamy outwash Flood plain elevation, if applicable NA ft

S=Suitable for system	Conventional <input checked="" type="checkbox"/> <input type="checkbox"/> U	Mound <input checked="" type="checkbox"/> S <input type="checkbox"/> U	In-Ground Pressure <input checked="" type="checkbox"/> S <input type="checkbox"/> U	AT-Grade <input checked="" type="checkbox"/> S <input type="checkbox"/> U	System in Fill <input type="checkbox"/> S <input checked="" type="checkbox"/> U	Holding Tank <input type="checkbox"/> S <input checked="" type="checkbox"/> U
-----------------------	---	--	---	---	---	---

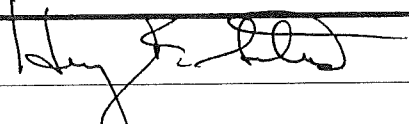
SOIL DESCRIPTION REPORT

Boring#	Horizon	Depth in.	Dominant Color Munsell	Mottles Qu. Sz. Cont. Color	Texture	Structure Gr. Sz. Sh.	Consistence	Boundary	Roots	GPD/ft ²	
										Bed	Trench
1 Ground elev 97.1 ft Depth to limiting factor > 90"	1	0-5	10YR 3/2	-	sl	2 m gr	ds	cs	2f1m	.5	.6
	2	5-10	10YR 3/2	-	sl	2 f sbk	ds	gs	1m	.5	.6
	3	10-29	10YR 4/3	-	sl	2 m sbk	dsh	gs	1m	.5	.6
	4	29-39	7.5YR 4/6	-	ls	1 m sbk	dsh	cw	-	.7	.8
	5	39-58	7.5YR 4/6	-	mcos	0 sg	dl	cs	-	.7	.8
	6	58-90	7.5YR 5/4	-	s	0 sg	dl	-	-	.7	.8

Remarks: 7.5YR 3/4 sl band @ 68-69"

2 Ground elev 97.2 ft Depth to limiting factor > 90"	1	0-3	10YR 3/2	-	sl	2 m gr	ds	cs	2f1m	.5	.6
	2	3-6	10YR 3/2	-	sl	2 f sbk	ds	cs	1m	.5	.6
	3	6-22	10YR 4/3	-	sl	2 m sbk	dsh	cs	1m	.5	.6
	4	22-34	7.5YR 4/6	-	sl	0 m	dvh	cs	1f	.3	.4
	5	34-43	7.5YR 4/6	-	ls	1 m sbk	dsh	cw	1m	.7	.8
	6	43-55	7.5YR 4/6	-	mcos	0 sg	dl	cs	1m	.7	.8
	7	55-90	7.5YR 5/4	-	s	0 sg	dl	-	-	.7	.8

Remarks:

CST Name (Please Print) Henry F. Grote	Signature: 	Telephone No. 715-665-2681
Address Certified Soil Testing P.O. Box 57, Knapp, WI 54749	Date 12/6/1999	CST Number 222774 Ref # 1267

SOIL DESCRIPTION REPORT

PROPERTY OWNER: Liptak, Les
PARCEL I.D.# CSM Pending from Lot 10

Horizon	Depth in.	Dominant Color Munsell	Mottles Qu. Sz. Cont. Color	Texture	Structure Gr. Sz. Sh.	Consistence	Boundary	Roots	GPD/ft ²		
									Bed	Trench	
3 Ground elev 97.7 ft Depth to limiting factor > 90"	1	0-4	10YR 3/2	-	sl	2 m gr	ds	cs	1f/m	.5	.6
	2	4-24	10YR 4/3	-	sl	2 m sbk	ds	cs	1m	.5	.6
	3	24-38	7.5YR 4/6	-	sl	0 m	dvh	cs	1m	.3	.4
	4	38-50	7.5YR 4/6	-	ls	1 m sbk	dsh	cs	1m	.7	.8
	5	50-68	7.5YR 4/6	-	mcos	0 sg	dl	cs	-	.7	.8
	6	68-90	7.5YR 5/4	-	s	0 sg	dl	-	-	.7	.8

Remarks: occasional Ss frags 80-90"

4 Ground elev 97.5 ft Depth to limiting factor > 90"	1	0-5	10YR 3/2	-	sl	2 m gr	ds	cs	1f/m	.5	.6
	2	5-19	10YR 4/3	-	sl	2 m sbk	ds	cs	1m	.5	.6
	3	19-32	7.5YR 4/6	-	sl	0 m	dvh	cs	1m	.3	.4
	4	32-37	7.5YR 4/6	-	ls	1 m sbk	dsh	cs	1m	.7	.8
	5	37-52	7.5YR 4/6	-	mcos	0 sg	dl	cs	-	.7	.8
	6	52-90	7.5YR 5/4	-	s	0 sg	dl	-	-	.7	.8

Remarks:

5 Ground elev 96.9 ft Depth to limiting factor 64"	1	0-4	10YR 3/2	-	sl	2 m gr	ds	cs	1f/m	.5	.6
	2	4-24	10YR 4/3	-	sl	2 m sbk	ds	cs	1m	.5	.6
	3	24-34	7.5YR 4/6	-	sl	0 m	dvh	cs	1m	.3	.4
	4	34-56	7.5YR 4/6	-	ls	1 m sbk	dsh	cs	1m	.7	.8
	5	56-64	7.5YR 4/6	-	mcos	0 sg	dl	as	-	.7	.8
	6	64+	SSBR								

Remarks: horizon 4 has irregular 1/4-1/2" sl bands/inclusions

Ground elev Depth to limiting factor											

Remarks:

Les Lipstak - Plot Plan

CSM Pending Snow Lot 10
 Owners Address: SE-SE-17-2a.12.10
 Town: Tainter

